


Product Instructions

viEGA

2" Zero Lead PEX Press - Copper Fitting

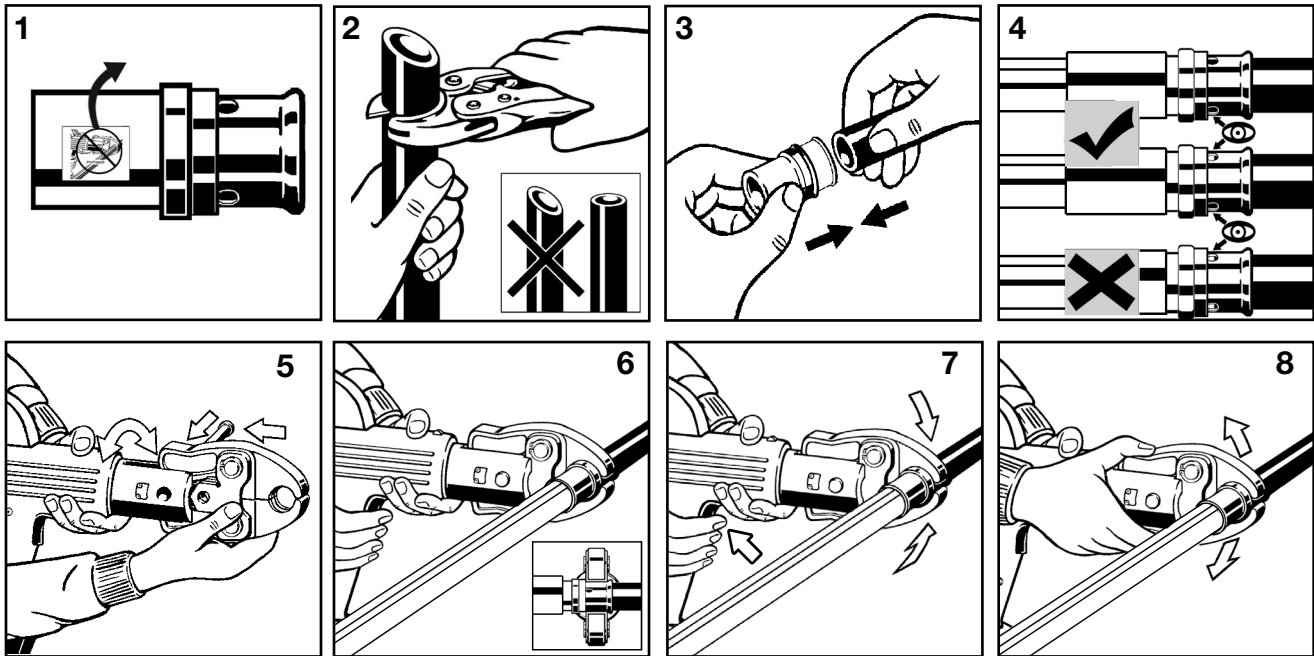

1. Remove orange warning sticker from fitting prior to making a solder connection. Clean off any glue residue before making connection. **Solder connection must be made before PEX Press connection.**
2. Square off tubing to proper length. Uneven, jagged or irregular cuts will produce unsatisfactory connections.
3. Insert PEX Press fitting with attached sleeve into tubing and engage fully.
4. Ensure full tubing insertion at view holes in attached press sleeve. Full insertion means tubing must be completely visible in at least two view holes and partially visible in the one.
5. Insert the appropriate PureFlow Press Jaw into the press tool and push in the holding pin until it locks.
6. Open jaw and position perpendicular over press sleeve resting it against the tool locator ring.
7. Start pressing process; hold the trigger until the jaw has automatically released.
8. When press connection is complete, open and remove jaw.



Warning! This fitting is designed for use with solder tubing fittings only and is not for use with ProPress tubing adapters!

"Zero Lead" identifies Viega products meeting the lead free requirements of California and Vermont law, effective January 1, 2010, as tested and listed against NSF- 61, Annex G

Viega... The global leader in plumbing and heating systems.

301 N. Main, 9th Floor • Wichita, KS 67202 • Ph: 800-976-9819 • Fax: 800-976-9817 • E-Mail: insidesales@viEGA.com • www.viEGA.com
PI-PF-560866 0411 (Zero Lead PEX Press - Copper Fitting)