
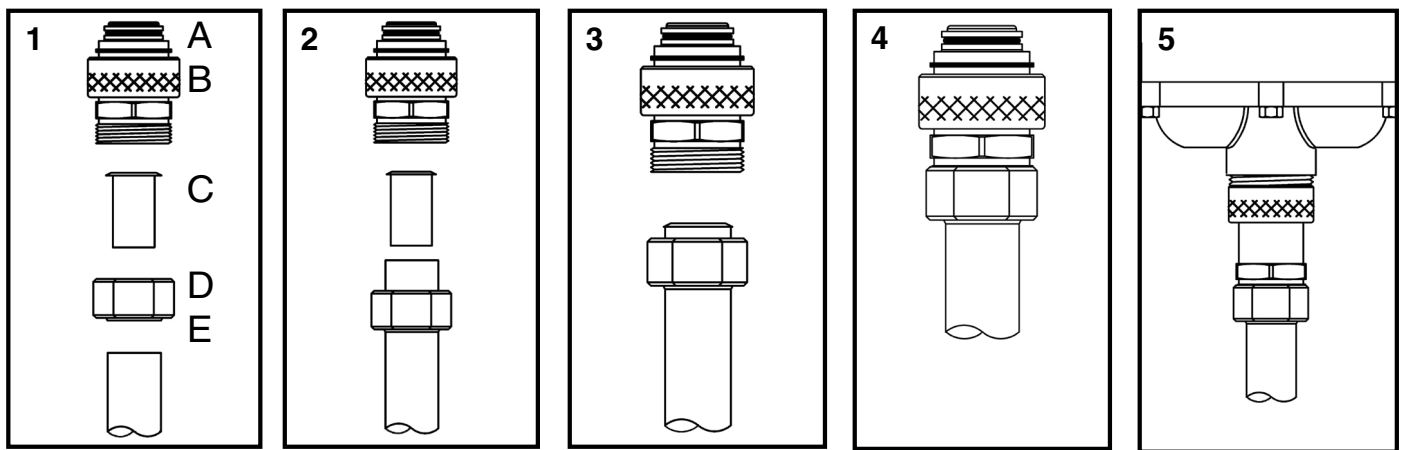


# Product Instructions

viEGA

## Zero Lead MANABLOC® Supply Adapter Connections Compression / Male NPT / End Cap

*THE WATER SUPPLY TO THE MANABLOC SHALL BE TURNED OFF BEFORE ATTEMPTING INSTALLATION OF CRIMP SUPPLY ADAPTERS.*



1. Insure the sealing element (A) is in place and clean of any dirt or debris. Wet sealing element with tap water.
2. Slide the supplied compression nut (D) with ferrule (E) onto the tubing (threads of the nut toward the end of the tubing). Nut comes assembled with ferrule.
3. Insert the supplied Stainless Steel Insert Stiffener (C) fully into the end of the PEX tubing as shown. Insert Stiffener is not required when making a connection to CPVC or copper tubing.
4. Insert the pipe fully into the MANABLOC Supply Adapter and thread compression nut onto fitting. Wrench tighten (supporting the HEX on fitting body with a crescent wrench) 1 to 1-1/4 turns past hand tight. The piping must not put stress on the MANABLOC as leaking damage may result.
5. Insert the fitting into the desired inlet/outlet port until the fitting flange sets flush with the port. Thread the nut (B) onto the MANABLOC inlet/outlet port. Hand tighten only. **DO NOT OVER TIGHTEN.**

**NOTE:** For male NPT MANABLOC adapters use only Teflon Tape to pipe threads. **DO NOT** use pipe dopes, thread sealers, Teflon pastes, etc. For the End Cap Adapter follow steps 1 and 5.

“Zero Lead” identifies Viega products meeting the lead free requirements of California and Vermont law, effective January 1, 2010, as tested and listed against NSF- 61, Annex G.

**Viega... The global leader in plumbing and heating systems.**

301 N. Main, 9th Floor • Wichita, KS 67202 • Ph: 800-976-9819 • Fax: 800-976-9817 • E-Mail: insidesales@viEGA.com • www.viEGA.com

PI-PF-560723 0111 (ZL MB Compression Supply Adapter)